


EPay 37,66



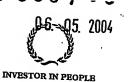


The Patent Office
Concept House
Cardiff Road
Newport
South Wales
NP10 800000
PC7

I, the undersigned, being an officer duly authorised in accordance with Section 74(1) and (4) of the Deregulation & Contracting Out Act 1994, to sign and issue certificates on behalf of the Comptroller-General, hereby certify that annexed hereto is a true copy of the documents as originally filed in connection with the patent application identified therein.

In accordance with the Patents (Companies Re-registration) Rules 1982, if a company named in this certificate and any accompanying documents has re-registered under the Companies Act 1980 with the same name as that with which it was registered immediately before re-registration save for the substitution as, or inclusion as, the last part of the name of the words "public limited company" or their equivalents in Welsh, references to the name of the company in this certificate and any accompanying documents shall be treated as references to the name with which it is so re-registered.

In accordance with the rules, the words "public limited company" may be replaced by p.l.c., plc, P.L.C. or PLC.

Re-registration under the Companies Act does not constitute a new legal entity but merely subjects the company to certain additional company law rules.

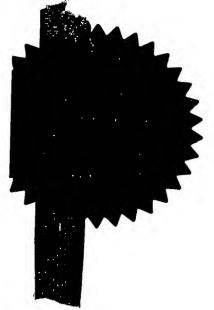

Signed Hardley

Dated 14 April 2004

PRIORITY DOCUMENT

SUBMITTED OR TRANSMITTED IN COMPLIANCE WITH RULE 17.1(a) OR (b)

Form 1/77 THE PATENT OFFIC Pateni ıct 1977 (Rule 16) JUN 2003

09JUNO3 E813252-1 D00393 .P01/7700 0.00-0313134.9

Request for grant of a patent

(See the notes on the back of this form. You can also get an explanatory leaflet from the Patent Office to help you fill in this form)

The Patent Office...

Cardiff Road Newport South Wales

NP10 8QQ Your reference 2003P08272 GB/ /CF/GD Patent application number 0313134.9 (The Patent Office will fill in this part) = 7 JUN 2003 Full name, address and postcode of the or of DEMAG DELAVAL INDUSTRIAL each applicant (underline all surnames) TURBOMACHINERY LIMITED Ruston House, Waterside South, Lincoln, Lincolnshire LN5 7FD 8648602001 Patents ADP number (if you know it) If the applicant is a corporate body, give the UNITED KINGDOM country/state of its incorporation Title of the invention TILT PAD BEARING PIN Name of your agent (if you have one) Siemens Plc "Address for service" in the United Kingdom Intellectual Property Department to which all correspondence should be sent The Lodge, Roke Manor (including the postcode) Romsey, Hampshire SO51 0ZN 8472193002 Patents ADP number (if you know it) If you are declaring priority from one or more Country Priority application number earlier patent applications, give the country Date of filing and the date of filling of the or of each these (if you know It) (day / month / year) earlier applications and (if you know it) the or each application number If this application is divided or otherwise derived from an earlier UK application, give the number and the filling date of the earlier application Is a statement of inventorship and of right

Yes

this request? (Answer, Yes' if:

to grant of a patent required in support of



Pateril (Rule 16)

et 1977

Patent Office

1/7/7

•	a) any application named in part 3 is not an inventor,	or .	
	b) there is an inventor who is not named as an applicant, or		
	c) any named applicant is a corporate body.		
	See note (d))	•	,
9.	Enter the number of sheets for any of the		
	following items you are filling with this form.		
	Do not count copies of the same document		
	Continuation sheets of this form	n •	
	Description	13	
	•	,	6-7.
	Claim(s) o	8
	Abstrac	. 0	•
	. Drawing <i>(s</i> ,	0	
			•
10.	If you are also filing any of the following, state how many against each item.		
	y, agamer each norm.		• .
	Priority documents		
	Translation of priority documents		
	Statement of inventorship and right	1 /	
	to grant a patent (Patents Form 7/77)		,
	Request for preliminary examination	·	
	and search (Patents Form 9/77)		
	Request for substantive examination		•
	(Patents Form 10/77)		
٠	Any other documents	Dave ch no	01110425
	(please specify)	pescript on	drawings a graph b.
11:			
		I/We request the grant of a	patent on the basis of this application
		Signature	Date
		Cherel.	
		Clive French	00.00.000
12	Name and deather to be	Intellectual Property Depa	06.06.2003 rtment
	Name and daytime telephone number of Person to contact in the United Kingdom	Clive French	+ 44 1794 83 3573



Tilt pad bearing pin for ------gas-turbine-rotor shaft bearings-

Background.

Gas turbine engine rotor shaft bearing assemblies may be of the plain bearing type which are segmented (radially self-aligning), retained in an outer carrier, oil pressure lubricated and known as tilt pad bearings. Such bearings are subject to high speed and load when the engine is running and very small out of limit wear in a bearing can have disastrous effects on an engine. It may cause engine shutdown which, for this kind of engine, is usually a very costly matter. For acceptable engine life it is therefore vital the bearings perform reliably.


It is typical in such segmented plain bearing arrangements to restrain radial movement of each segment by use of location pins which are fixed in the bearing assembly outer carrier and abut to segments either at segment end faces or at the side face of an internal hole or passage in the segment body. It is also typical the pin will be a parallel round pin throughout its length, but a known variation is for a pin with spheroid tip on a round pin stem, the sphere diameter being greater than the round pin stem.


It has been found that at contact faces between the bearing segments and bearing outer carrier, fretting wear may occur which allows segments to move beyond design limits and thus cause bearing related engine problems. It is believed the fretting is caused by a small amount of sliding action under pressure between segment and carrier and that the action is made possible with prior art pin designs. The subject invention, a tapered pin, prevents the sliding action and thus there is no fretting wear.

ing - Pads Restrained by End Pins

Sliding Distance

Pad OD	Angle	Sliding Distance
89.3mm	0.1°	8.7µm
85mm	0.1°	8.7μm

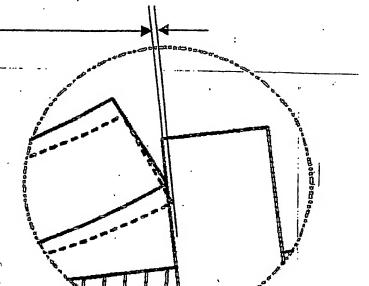

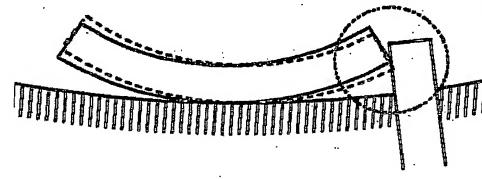

·Pad Sliding

Fretting is only possible with a sliding contact between metal surfaces. It is not possible if the motion of the pads in the carrier is purely rocking.

Sliding can occur in a circumferential direction with both Glacier and Sartorius bearings

If a tilt pad was able to rock freely, the edges of the pad would move radially and circumferentially as the pad rocks. Glacier bearing pads are prevented from moving circumferentially by pins between the pads, so the edge of the pad has to stay in contact with the pin, and the back of the pad has to slide against the carrier

Pad Sliding - Pads Restrained by Centre Pins

			,
Pad OD	Angle	Sliding Distance	Sliding
89.3mm	0.1°	3.6µm	Distance
85mm	0.1°	3.6µm	
For distance do	both designes not vary	ns, sliding with pod (

Consequences of Bearing Wear

The consequence of the wear is an increase in bearing clearance, an increased maintenance cost to replace the bearings, and a reduced level of availability if bearings have to be changed at site

The increase in bearing clearance reduces the stiffness and damping of the bearing, reducing its tolerance to unbalance and other exciting forces

In some applications, eg. Typhoon inlet bearing, this increase in bearing clearance results in an increased level of measured shaft vibration

Degree of Bearing Wear

The maximum wear depth measured is 60µm on a pad. The wear on the carrier is generally equal to the amount on the pad. The amount of wear is variable, and depends on many factors, including:

- Number of hours and starts run
- Bearing supplier
- Which engine type and which bearing
- Position of bearing pad within the module

Other factors that may be relevant are;

- Hardness of bearing pads and carrier
- Clearance of bearing
- Surface finish of bearing and carrier
- Unbalance and vibration level



A number of examples have been examined. The cause is considered to be fretting.

Electrical discharge pitting has been eliminated as a cause of weak Fretting occurs when sliding surfaces wear away the oxide surface layer and expose bare metal surfaces. The sliding of these surfaces produces small particles either by repeated microwelding and breaking apart of the material surface, shearing of interlocking surface asperities or fatigue of asperities. These particles form a hard oxide (Fe_2O_3) and accelerate the rate of material removal Each pad rocks with each revolution of an unbalanced shaft. The pad slides against the carrier because the whirling oil forces the pad circumferentially against the location pin as it rocks

There are a number of changes that have been made to the engines and bearings that may contribute to the faster fretting of the bearings:

The reduction of the bearing clearance

 Use of bearings in applications where there is a higher level of synchronous and non-synchronous excitation eg. From Typhoon gearbox or Cyclone auxiliary gearbox shaft

Factors in Fretting

The single most influential

factor in fretting is the amplitude of surface sliding Secondary factors are

- material hardness
- surface finish
- contact pressure
- lubrication.

Possible causes of increased bearing fretting related to the change of supplier:

- material change. The composition of the material may be different.

geometry change. On at least two bearing types, the <u>outer radius</u> of the pad is reduced. This causes higher contact pressure. Also the <u>bearing preload</u> and <u>circumferential length</u> may have changed. If so, these could also affect the reaction loads. The <u>method of locating</u> the pads has changed from end pins to a central pin. This may affect the amplitude of sliding.

surface finish

Pad Sliding

Fretting is only possible with a sliding contact between metal surfaces. It is not possible if the motion of the pads in the carrier is purely rocking.

Sliding can occur in a circumferential direction with both Glacier and Sartorius bearings

If a tilt pad was able to rock freely, the edges of the pad would move radially and circumferentially as the pad rocks. Glacier bearing pads are prevented from moving circumferentially by pins between the pads, so the edge of the pad has to stay in contact with the pin, and the back of the pad has to slide against the carrier

There are 2 possible reasons why a reduction in bearing clearance may cause increased fretting:


- increase in contact load. The reduced clearance bearing operates with a thinner oil film, and a higher oil film pressure. This pressure is reacted with a higher force at the back of the pad. The forced sliding of the pad will wear faster with an increased reaction load sliding of the pad will wear faster with an increased reaction load.

increase in sliding amplitude and velocity. Initial calculations
 indicate that the angular rocking of the pads with an unbalanced shaft is higher with a reduced clearance bearing. The sliding


will also be increased

Pad Sliding - Pads Restrained by Centre Pins

□C Jb	Angle	Sliding Distance
89.3mm	0.1°	3.6µm
85mm	0.1°	3.6µm

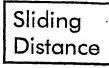


For both designs, sliding distance does not vary with pad OD

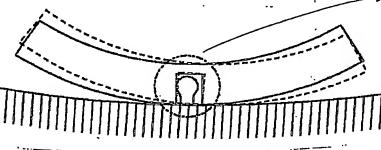

Bearing Pad Angles

learing	Unbalance	Vibration Amplitude			Tilt Angle	
yclone nlet	10 kN at CT2	70 μm	155 μm	0.45	0.07°	
yclone nlet	20 kN at CT2	110 μm	155 μm	0.71	0.11°	
yclone T	10 kN at CT2	53 μm	321 μm	0.17	0.045°	
yclone T	20 kN at CT2	95 μm	321 μm	0.30	0.06°	

Pad Tlit Angle v Vibration Amplitude/Clearance

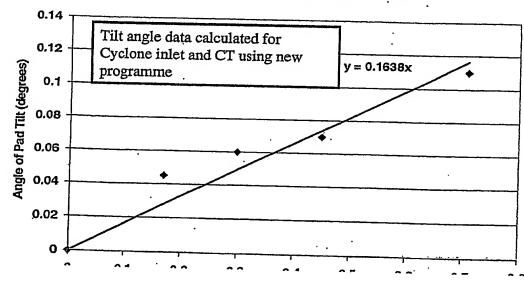

Wear Patterns

On almost every bearing, the wear on the bottom 2 pads is significantly higher than on the other pads. The top pad almost always shows the least wear

Bearing reaction load is highest on the bottom 2 pads and lowest on the top pad

EITHER

Contact load is the key parameter for bearing wear OR Some other key parameter is worst on the bottom 2 pads

NB. Hardness, surface finish cannot be worst at the bottom. Tilt angle and sliding distance may be slightly higher on the bottom pads

Flutter is not the cause of bearing wear

Overall Conclusions So Far


The highest wear is seen on the most highly loaded pads
The contact stress on the bottom pads has increased due to
both a decrease in the pad radius and a reduction in
clearance. This is likely to have increased the rate of wear
The hardness of the pads has decreased

The mounting of the pads on centre pins is likely to cause less fretting than mounting with end pins

The fretting of centre-pin mounted pads could be reduced with conical pins


Pad Sliding - New Centre Pin Design

Sliding Distance reduced to near zero.
Potential for fretting removed.

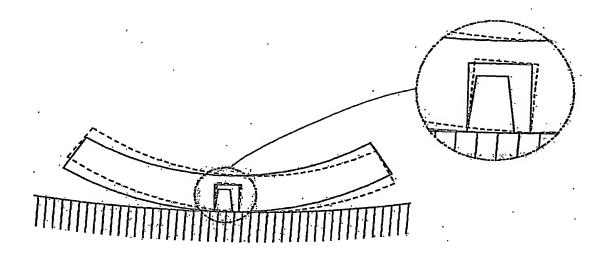

orn ----> Machined


Fretted Surface

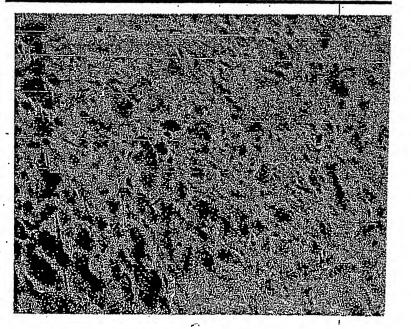

Pad Sliding - New Centre Pin .

Sliding Distance reduced to near zero.

Potential for fretting removed.

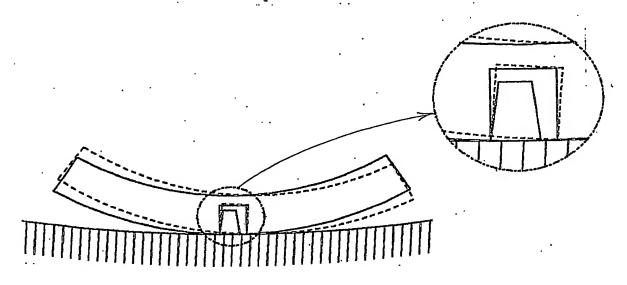

Bearing Pad Tilt Angle and Sliding Distance

For each bearing, 60mm vibration assumed. Tilt angle calculated from slope of plot.

Bearing	Vibration Amplitude / Clearance	Tilt Angle (Calculated)	Sliding Distance
RW Inlet (RW12031B)	0.32	0.056	1
Cyclone/RW Inlet (MW12013)	0.39	0.067	
Cyclone CT/ RW CT	0.19	0.032	
RM Inlet (12031C)	0.35	0.061	
RM Inlet (12031D)	0.44	0.075	
RM CT	0.26	0.045	
RT CT (32022A)	0.29	0.050	
RT CT (32022B)	0.33	0.057	

Bearing Pad Contact Stress

RM Inlet Bearing, RM12013, 12031-12031D

Contact stress between pad backing and carrier for a perfectly balanced rotor (static loading)

a state of the contract and security of the security of the security was a security of the contract of	Glacier	(013)	Sartoriu	ıs (31C)	Sartorio	us (31D)	
	Original (Clearance	Original (Clearance	Reduced	Clearance	
	Top pad	Bottom	Top pad	Bottom	Top pad	Bottom	
Pad reaction load =	123	1126	123	1126	397	1422	N
Pad outer diameter $D_2 =$	89.3	89.3	85.0	85.0	85.0	85.0	mmi
Contact stress =		* -					

19


RM Inlet Bearing, RM12013, 12031-12031D


Additional dynamic contact stress from 1000gmm unbalance on the inlet bearing


						•	
and the same of th	Glacie	r (013)	Sartoriu	is (31C)	Sartoriu	us (31D)	
the second secon	Original C	Clearance	Original (Clearance	Reduced	Claaranaa	·
	Top pad	Bottom	Top pad	Bottom	Top pad	Bottom	· · ·
Pad reaction load =	1525	1525	1525	1525	2146	2146	N
Pad outer diameter $D_2 =$	89.3	89.3	85.0	85.0	85.0	85.0	14
Contact stress =	33	33	44				mm _.
Total contact stress =			44	44	51	51	MPa
(static + dynamic)	3	X 3	5				
	Street, Sales Sile						MPa



Vibration on Bulwer Cyclone

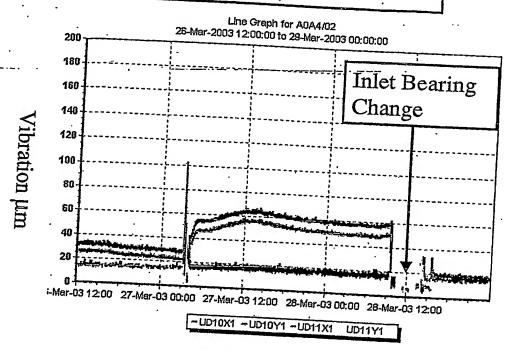

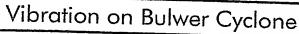

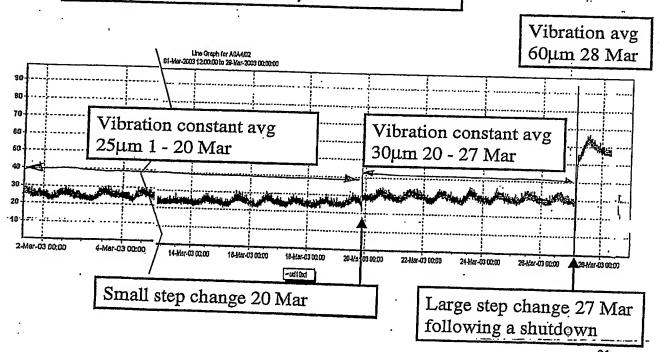

· /ibration on Bulwer Cyclone - Conclusions

tep changes within March 2003

learing wear cannot occur in steps

learing clearance must have increased steadily


learing wear is not the cause of the vibration increase

ibration level on the Cyclone inlet bearing is not ensitive to bearing clearance

argest increase in vibration occurs after a shutdown

hanges during a shutdown could be a cause of bration

Vibration Carberry Milk Typhoon

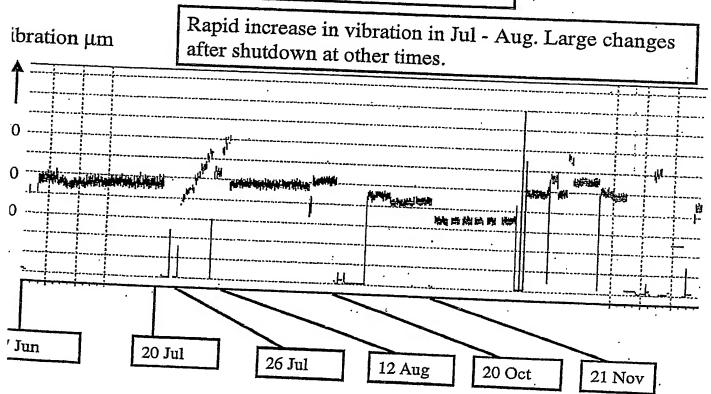

A change in July caused the vibration to start increasing. This could be due to bearing pad wear

This Page is Inserted by IFW Indexing and Scanning Operations and is not part of the Official Record

BEST AVAILABLE IMAGES

Defective images within this document are accurate representations of the original documents submitted by the applicant.

Defects in the images include but are not limited to the items checked:

BLACK BORDERS

☐ BLACK BORDERS
\square IMAGE CUT OFF AT TOP, BOTTOM OR SIDES
☐ FADED TEXT OR DRAWING
BLURRED OR ILLEGIBLE TEXT OR DRAWING
☐ SKEWED/SLANTED IMAGES
\square COLOR OR BLACK AND WHITE PHOTOGRAPHS
☐ GRAY SCALE DOCUMENTS
LINES OR MARKS ON ORIGINAL DOCUMENT
☐ REFERENCE(S) OR EXHIBIT(S) SUBMITTED ARE POOR QUALITY
Потиев.

IMAGES ARE BEST AVAILABLE COPY.

As rescanning these documents will not correct the image problems checked, please do not report these problems to the IFW Image Problem Mailbox.